



Test Report

Report No.: HLF1403091E

Report Date: 2014-3-10

Page: 1 of 4

Company Name : Leading Sponge Limited

Address : Shadun Industrial Areas, Zengbu, Chashan Town, Dongguan, Guangdong, China

The following sample information was Submitted and Identified by the Client:

Sample Name : Activated carbon filter sponge

Sample model : /

Sample Lot : /

Receiving Date : 2014-3-6

Complete Date: : 2014-3-10

Test Requested : According to client's requirement, Determine the content of Phthalates in the submitted sample

Test Method : Please refer to next page

Test Results : Please refer to next page

Prepared by: Cathy
Report Clerk

Checked by: Mary
Lab Senior Engineer

Approved by: Eric
Lab Supervisor

In no circumstances shall the Company's responsibility extend beyond inspection, testing and reporting upon the samples actually drawn from the bulk and inspected, tested and surveyed by the Company and any inference to be drawn from the results of such inspection or survey or testing shall be entirely in the discretion and at the sole and exclusive responsibility of the Principal. This test report cannot be reproduced except in full.



FLSION TESTING SERVICE

Add: Gangzi Industrial Park, Furong Industrial Area, Xinqiao Village, Shajing Town, Bao'an District, Shenzhen City

Tel: 86-0755-2724 8885

Fax: 86-0755-2746 0090

Http://www.sz-fts.com

Test Report

Report No.: HLF1403091E

Report Date: 2014-3-10

Page: 2 of 4

Test Result:

Test Item	Test Method / Instrument	Unit	MDL	Result (A)	Limit
Dimethyl Phthalate (DMP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Diethyl Phthalate (DEP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Diiso butyl Phthalate (DIBP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Dibutyl Phthalate (DBP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Dimethoxyethyl phthalate (DMEP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Diisohexylphthalate (DMPP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Diethoxyethylphthalate (DEEP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Di-1-pentylphthalate (DPP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
1,2-benzenedioic acid dihexyl ester (DHXP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Benzylbutyl Phthalate(BBP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Bis(2-butoxyethyl)phthalate (BBEP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Dicyclohexyl Phthalate (DCHP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Bis-(2-ethylhexyl) Phthalate(DEHP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Phthalic acid diphenyl (DPHP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
di-1-octylphthalate (DNOP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Dinonyl Phthalate (DNP)	EN14372(2004)/GC-MS	%	0.005	N.D.	0.1
Diisononyl Phthalate (DINP)	EN14372(2004)/GC-MS	%	0.01	N.D.	0.1
Diisodecyl Phthalate (DIDP)	EN14372(2004)/GC-MS	%	0.01	N.D.	0.1

Note: 1.1ppm=1mg/kg=0.0001%; 2.N.D.=Not Detected(<MDL);
3.MDL=Method Detection Limit; 4.“--”=Not Regulated;

In no circumstances shall the Company's responsibility extend beyond inspection, testing and reporting upon the samples actually drawn from the bulk and inspected, tested and surveyed by the Company and any inference to be drawn from the results of such inspection or survey or testing shall be entirely in the discretion and at the sole and exclusive responsibility of the Principal. This test report cannot be reproduced except in full.



FLION TESTING SERVICE

Add:Gangzi Industrial Park, Furong Industrial Area, Xinqiao Village, Shajing Town, Bao'an District, Shenzhen City

Tel: 86-0755-2724 8885 Fax:86-0755-2746 0090 Http://www.sz-fts.com


Test Report

Report No.: HLF1403091E

Report Date: 2014-3-10

Page: 3 of 4

Testing Flow Chart:

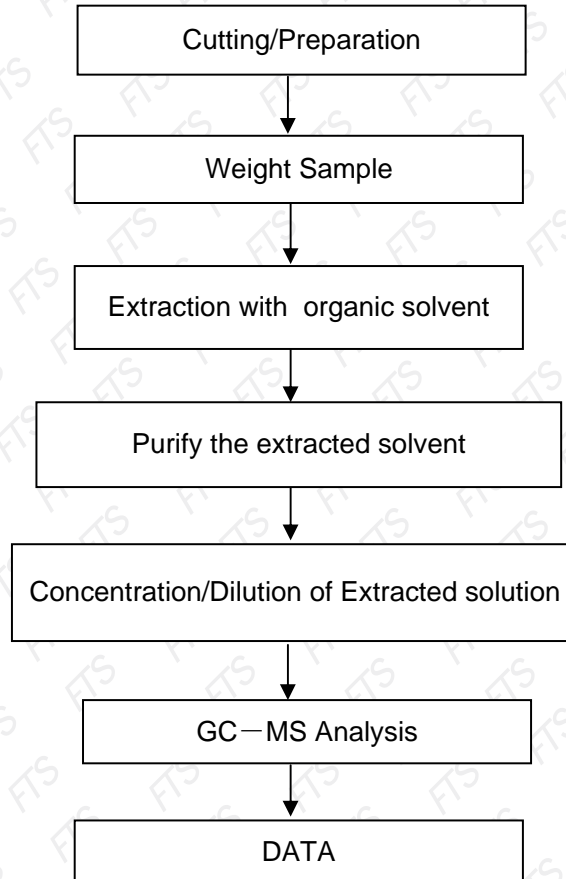

In no circumstances shall the Company's responsibility extend beyond inspection, testing and reporting upon the samples actually drawn from the bulk and inspected, tested and surveyed by the Company and any inference to be drawn from the results of such inspection or survey or testing shall be entirely in the discretion and at the sole and exclusive responsibility of the Principal. This test report cannot be reproduced except in full.



FLION TESTING SERVICE

Add: Gangzi Industrial Park, Furong Industrial Area, Xinqiao Village, Shajing Town, Bao'an District, Shenzhen City

Tel: 86-0755-2724 8885

Fax: 86-0755-2746 0090

Http://www.sz-fts.com

Test Report


Report No.: HLF1403091E

Report Date: 2014-3-10

Page: 4 of 4

Sample Description: A: sponge

Sample photo:

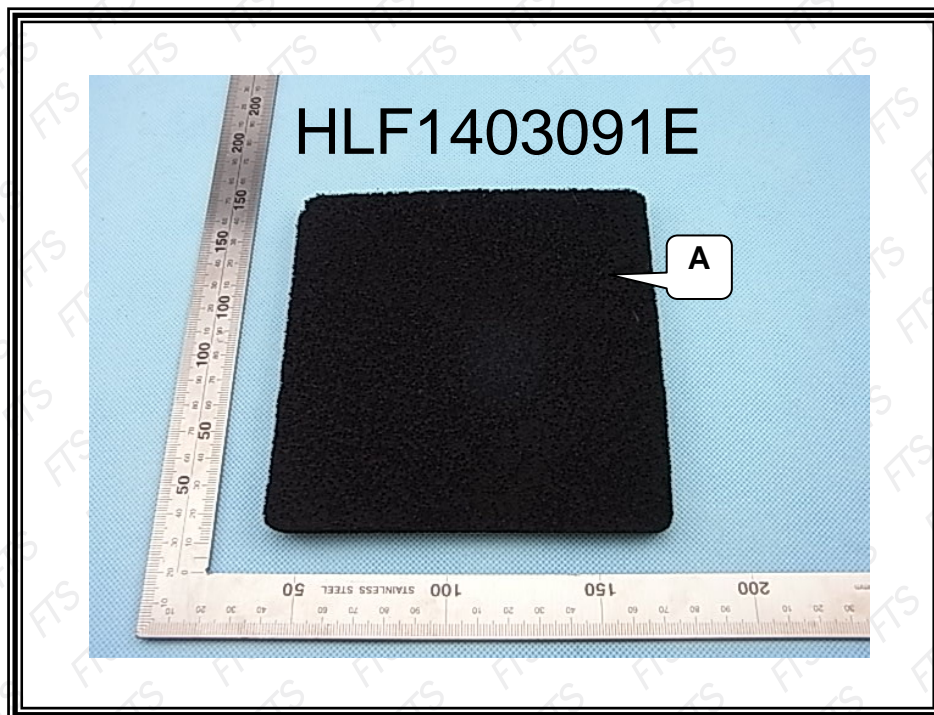

Note: The results show in this report is only responsible for the sample. The test report shall not be reproduced except in full, without written approval of the laboratory.

***** End of the report *****

In no circumstances shall the Company's responsibility extend beyond inspection, testing and reporting upon the samples actually drawn from the bulk and inspected, tested and surveyed by the Company and any inference to be drawn from the results of such inspection or survey or testing shall be entirely in the discretion and at the sole and exclusive responsibility of the Principal. This test report cannot be reproduced except in full.



FLION TESTING SERVICE

Add: Gangzi Industrial Park, Furong Industrial Area, Xinqiao Village, Shajing Town, Bao'an District, Shenzhen City

Tel: 86-0755-2724 8885

Fax: 86-0755-2746 0090

Http://www.sz-fts.com